


Executive Order G-70-191

Exhibit 2

Figure 2B-3

Healy A/L Adapter For 600 ORVR and 800 Nozzle Healy Part # 8034

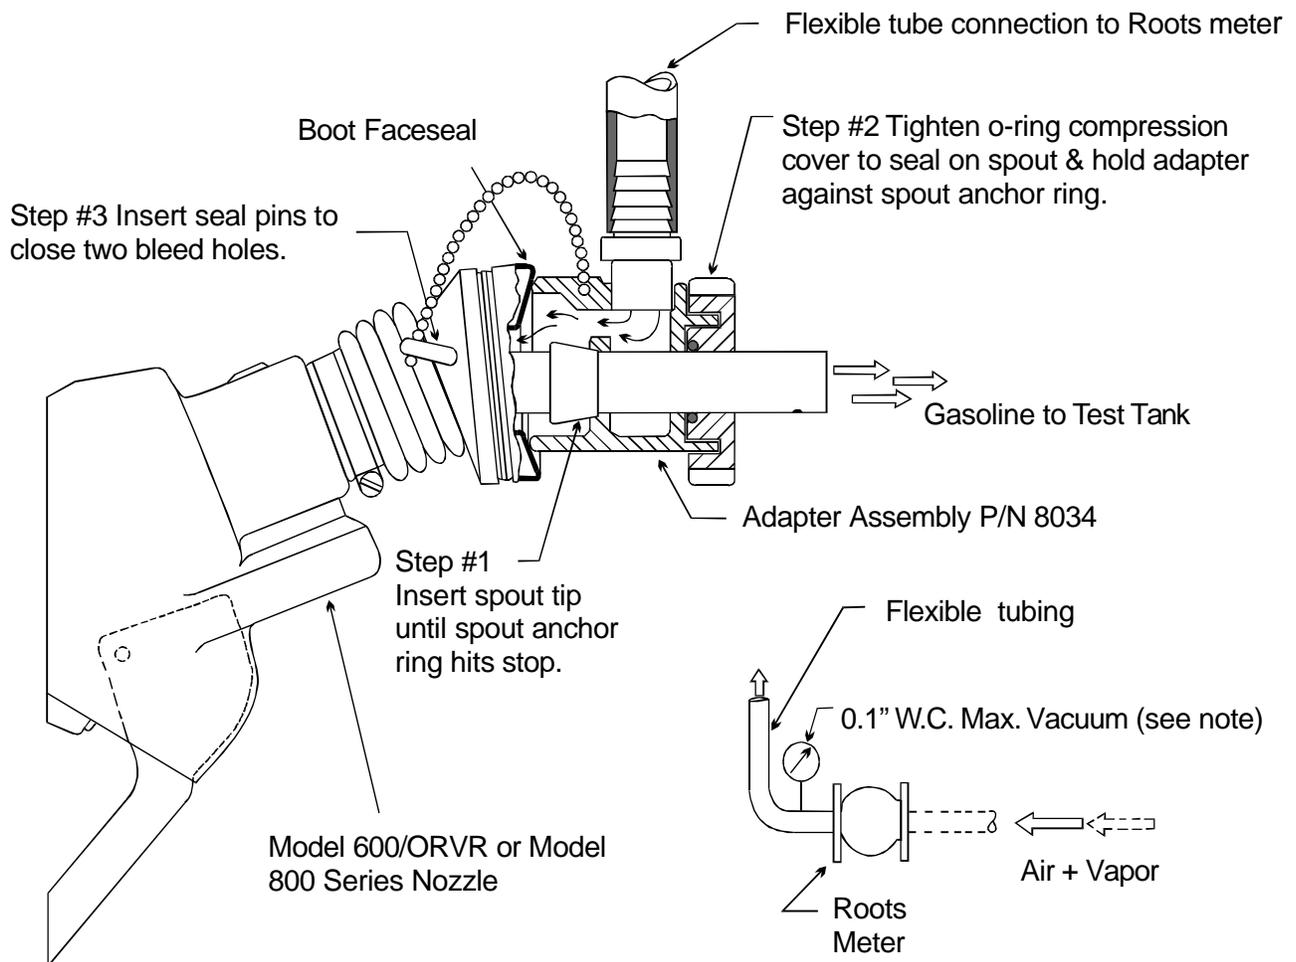

OPERATION INSTRUCTIONS

- Step #1 Slide A/L adapter along spout & compress boot until A/L adapter contacts spout anchor ring.
- Step #2 Tighten o-ring compression cover to seal on spout & hold adapter against spout anchor ring.
- Step #3 Insert pins to seal two bleed holes directly behind face seal assembly.
- Step #4 Proceed with A/L or V/L test. (see note)
- Step #5 Remove seal pins from bleed holes in boot; loosen o-ring compression cover & remove A/L adapter.

Note: Warning - vacuum level greater than 0.1" W.C. May activate ORVR sensor causing a substantial decrease (error) in A/L or V/L ratio. Clean Roots meter per mfg. instructions as required.